

Electrolube® SWAT

Safewash Total

DESCRIPTION

Electrolube® SWAT is a specially formulated blend of non-flammable solvents which forms a micro-emulsion when mixed with water. Designed for cleaning printed circuit boards, it is ideal for the safe removal of all types of paste, adhesive and flux residues, including no-clean. Supplied as a concentrate, **SWAT** contains a corrosion inhibitor allowing the safe cleaning of sensitive metals including copper and aluminum. SWAT is part of the Safewash range; water-based, non-flammable, biodegradable solvent blends designed to clean to within military cleanliness standards, (ANSI-J-001B/IPC TM-650).

READ ENTIRE TECHNICAL DATA SHEET BEFORE USING THIS PRODUCT

FEATURES AND BENEFITS

- Micro-emulsion with high solvency for removal of flux residues; ideal for stubborn deposits
- Low foaming action; suitable for use in pressure wash systems as well as ultrasonic equipment
- Supplied as a concentrate; allows versatility and control in the production process
- Non-flammable product, 100% ozone friendly; suitable for use in standard cleaning equipment

APPROVALS

Standard	Status
RoHS Compliant (2015/863/EU)	Yes

PRODUCT INFORMATION

Please contact your customer service representative for information on available package sizes.

PHYSICAL PROPERTIES

Category	Results
Typical Properties Concentrate	
Appearance	Clear, Colorless Liquid
Density @ 20 °C (g/mL)	0.93
pH	11
Boiling Point (°C)	>160
Flash Point (°C)	Non-Flammable
Freezing Point (°C)	< -50
Viscosity @ 20 °C (mPa s)	40
Conductivity @ 18 °C (mS)	<0.2

APPLICATION GUIDELINES

Safewash Total is a low foam cleaner, suitable for use in dishwasher and in-line pressure systems, as well as Ultrasonic and spray under immersion applications. In the event that contaminants to the cleaning solution cause foaming during use, additions of Safewash Defoamer (SWD) can be made as necessary.

Spray Application

For a typical application, Safewash Total should be diluted to 20% with de-ionized water and applied for a wash time of 5 to 10 minutes at 40 to 60 °C. The specific cycle required will be dependent on the age and type of residue being removed, the reflow profile and the effectiveness of the cleaning machine. The cleaning stage should be followed by a deionized water rinse and a drying stage. The length of time required for rinsing and drying the PCB depends on the circuit design and the efficiency of the rinsing/drying unit. Air-knives can be used as an optional extra to reduce temperature or total energy required.

A typical cycle using a Miele 6002 Industrial Washer:

1. Cleaning, Safewash Total diluted to 20% v/v, at 50 °C for 10 minutes
2. Mains water rinse, 1 minute at 40 °C
3. De-ionized water rinse, 3 minutes at 70 °C
4. Hot air dry, 15 minutes at 115 °C

Once cooled to below 30 °C the residues and soils will precipitate and can be filtered out of the cleaning solution, extending the life of the cleaner. Typically, a 50 to 75 micron cotton wound filter would be suitable.

Ultrasonic and Spray Under Immersion Application

Application Temperature: Typically, 30 to 40 °C






Application Concentration: Typically, 15%

For immersion applications, Safewash Total should be diluted with deionized water to typically 15%. The cleaning time will depend on the nature of the residues and the process temperature but is typically 5 to 15 minutes. The wash stage should be followed by thorough rinsing in deionized water and drying.

Solution Control

There are a number of methods that can be used to monitor the concentration of the cleaning solution and the level of contamination. The suitability of the methods will depend on the specific application; they can be affected by type of residue being removed by the cleaner, the quality of the water used to make the solution and also the effectiveness of the filtration system. Cleaning efficiency in the application should be monitored and the cleaning solution replaced as necessary. The following graphs provide some starting points for monitoring solutions of SWAT.

The cloud temperature can be measured by gently heating a sample of solution from ambient and noting the temperature at which it becomes cloudy. Refractive index (or BRIX) is a simple test for solution control. Small handheld refractometers can be purchased from suppliers such as Bellingham and Stanley, at a low cost. Both pH and conductivity are also valid methods for solution control however the change with increasing contamination uptake will depend on the residues removed. In all cases, the method for solution control should be evaluated in the specific application.

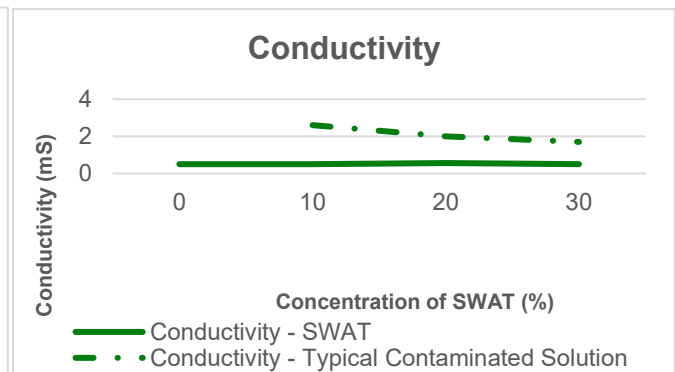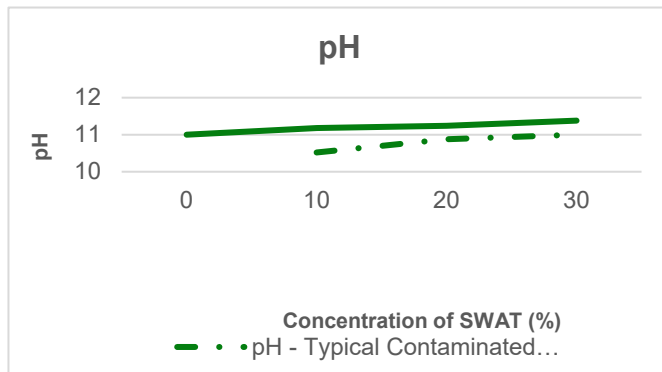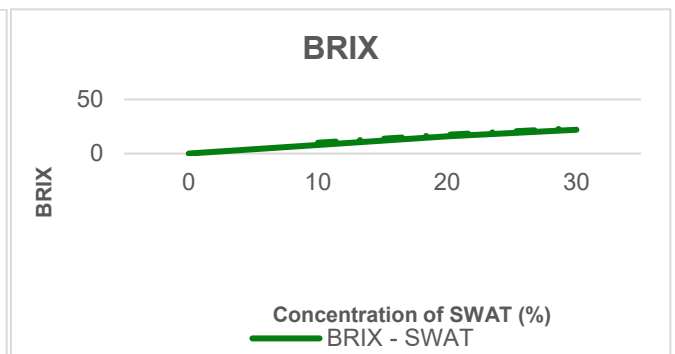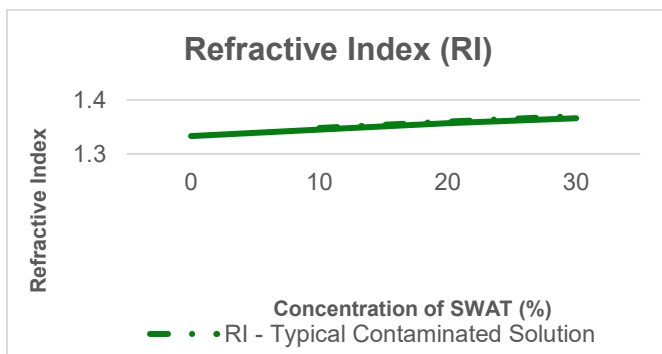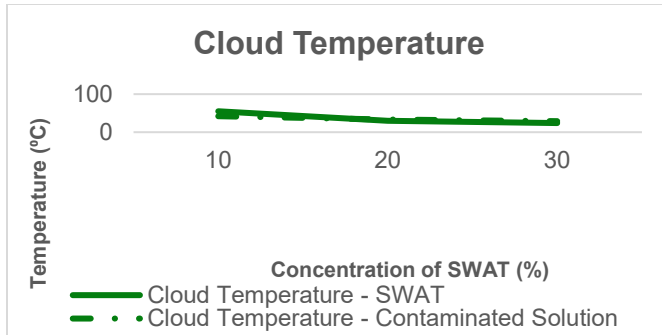

ADDITIONAL INFORMATION

Shelf Life

Description	Shelf Life
Safewash Total	48 Months
Safewash Defoamer	24 Months

SAFETY & WARNING

It is recommended that the company/operator read and review the Safety Data Sheets for the appropriate health and safety warnings before use. **Safety Data Sheets are available.**

CONTACT INFORMATION

www.macdermidalpha.com

<p>North America 140 Centennial Avenue Piscataway, NJ 08854 1.800.367.5460</p>	<p>Europe Ashby Park Coalfield Way Ashby de la Zouch Leicestershire, LE65 1JR, UK 44.01530.41960</p>	<p>Asia 8/F., Two Sky Parc 51 Hung To Road Kwun Tong, Kowloon, Hong Kong, SAR China 852.2500.5365</p>
---	---	--

Also read carefully warning and safety information on the Safety Data Sheet. This data sheet contains technical information required for safe and economical operation of this product. READ IT THOROUGHLY PRIOR TO PRODUCT USE . Emergency safety directory assistance: US 1 202 464 2554, Europe + 44 1235 239 670, Asia + 65 3158 1074, Brazil 0800 707 7022 and 0800 172 020, Mexico 01800 002 1400 and (55) 5559 1588

DISCLAIMER: All statements, technical information and recommendations contained herein are based on tests we believe to be reliable, but the accuracy or completeness thereof is not guaranteed. No statement or recommendation shall constitute a representation unless set forth in an agreement signed by officers of seller and manufacturer. NO WARRANTY OF MERCHANTABILITY, WARRANTY OF FITNESS FOR A PARTICULAR PURPOSE OR ANY IMPLIED WARRANTY IS MADE. The following warranty is made in lieu of such warranties and all other warranties, express, implied, or statutory. Products are warranted to be free from defects in material and workmanship at the time sold. The sole obligation of seller and manufacturer under this warranty shall be to replace any noncompliant product at the time sold. Under no circumstances shall manufacturer or seller be liable for any loss, damage or expense, direct, indirect, incidental or consequential, arising out of the inability to use the product. Notwithstanding the foregoing, if products are supplied in response to a customer request that specifies operating parameters beyond those stated above, or if products are used under conditions exceeding said parameters, the customer by acceptance or use thereof assumes all risk of product failure and of all direct, indirect, incidental and consequential damages that may result from use of the products under such conditions, and agrees to exonerate, indemnify, defend and hold harmless MacDermid, Incorporated and its affiliates therefrom. No suggestion for product use nor anything contained herein shall be construed as a recommendation to use any product in a manner that infringes any patent or other intellectual property rights, and seller and manufacturer assume no responsibility or liability for any such infringement.

© 2019 MacDermid, Inc. and its group of companies. All rights reserved. "(R)" and "TM" are registered trademarks or trademarks of MacDermid, Inc. and its group of companies in the United States and/or other countries.